HS-104S Low Power Accelerometer

AC acceleration output via M12 Connector


Key Features


- Low voltage
- · Ultra low power consumption
- · Side entry for easy access

Industries

Building services, Pulp and Paper, Mining, Metals, Utilities, Automotive, Water, Pharmaceutical



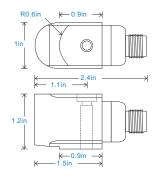

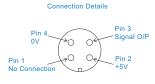

Technical Performance

Mounted Base Resonance see 'How To Order' table (nominal)
Sensitivity see: 'How To Order' table ±10%
Nominal 80Hz at 72°F
Frequency Response 18cpm (0.3Hz) to 600kcpm (10kHz) ± 10%
Isolation Base isolated
Range see: 'How To Order' table @ 5V power
Transverse Sensitivity Less than 5%

Mechanical

±1%

Case Material Stainless Steel
Sensing Element/Construction PZT/Shear
Mounting Torque 5.9ft. lbs
Mounting Bolt Provided see: 'How To Order' table x 1.2in long
Weight 6.5 oz. (nominal)
Sheilded Cable Assembly HS-AC010 - straight
HS-AC011 - right angle
Mounting Threads see: 'How To Order' table

Electrical

Amplitude Linearity

Electrical Noise < 500µg
Power Requirements 5V nominal (other voltages 1.8 to 24V on request)
Current Consumption 100µA nominal at 5V supply (60µA at 1.8V)
Bias Voltage 50% of supply voltage
Settling Time 1 second
Output Impedance 100 Ohms max.
Case Isolation >108 Ohms at 500 Volts

Environmental


 Operating Temperature Range
 -58 to 257°F

 Sealing
 IP67

 Maximum Shock
 5000g

 EMC
 EN61326-1:2013


Typical Frequency Response (at 100mV/g)

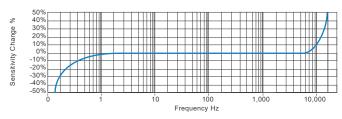


Applications

Fans, Motors, Pumps, Compressors, Centrifuges, Conveyors, Air Handlers, Gearboxes, Rolls, Dryers, Presses, Cooling, VAC, Spindles, Machine Tooling, Process Equipment

Vibration sensor should be firmly fixed to a flat surface (spot face surface may be needed to be produced and cable anchored to sensor body.)

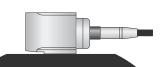

How To Order

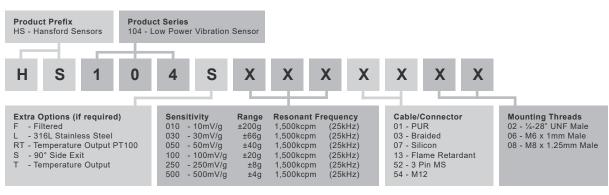



www.hansfordsensors.com sales@hansfordsensors.com

