# **HS-173 Premium Triaxial Accelerometer**

AC acceleration output via 4 Core Polyolefin HFFR


# **Key Features**

- · Output via three axes
- For use with data collector
- · Resistant to oil

#### Industries

Building services, Pulp and Paper, Mining, Metals, Utilities, Automotive, Water, Pharmaceutical



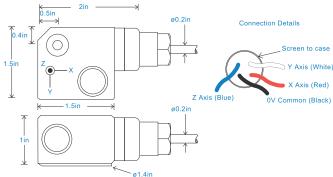

## **Technical Performance**

 $\begin{array}{c} \mbox{Mounted Base Resonance} & \mbox{see 'How To Order' table (nominal)} \\ & +3\mbox{kHz for aluminium version} \\ \mbox{Sensitivity} & \mbox{see: 'How To Order' table <math>\pm 10\%$ } \\ \mbox{Nominal 80Hz at } 72^{\circ}\mbox{F per axies} \\ \mbox{Frequency Response} & 120\mbox{cpm (2Hz) to } 600\mbox{kcpm (}10\mbox{kHz)} \pm 5\% \\ \mbox{90\mbox{cpm (}1.5\mbox{Hz) to } 720\mbox{kcpm (}12\mbox{kHz)} \pm 10\% \\ \mbox{48\mbox{cpm (}0.8\mbox{Hz) to } 900\mbox{kcpm (}15\mbox{kHz)} \pm 3\mbox{dB} \\ \mbox{Isolation} & \mbox{Base isolated} \end{array}

Isolation Base isolated Range see: 'How To Order' table Transverse Sensitivity Less than 5%

# Mechanical

Stainless Steel unless specified Aluminium Case Material Sensing Element/Construction PZT/Shear Mounting Torque 5.9ft. lbs see: 'How To Order' table x 1.2in long Mounting Bolt Provided Weight 8.3 oz. (nominal) - Stainless Steel Maximum Cable Length 3.280 ft. Standard Cable Length 16 ft. Polyolefin HFFR - length to be specified with order Screened Cable Mounting Threads see: 'How To Order' table Mounting Stud HS-AS226, HS-AS221 or HS-AS222 Submersible Depth 328 ft. max (10 bar)

#### Electrical

 Electrical Noise
 0.1mg max

 Current Range
 0.5mA to 8mA

 Bias Voltage
 10 - 12 Volts DC

 Settling Time
 1 second

 Output Impedance
 200 Ohms max.

 Case Isolation
 >108 Ohms at 500 Volts

# Environmental


 Operating Temperature Range
 -67 to 266°F

 Sealing
 IP68

 Maximum Shock
 5000g

 EMC
 EN61326-1:2013

# Typical Frequency Response (at 100mV/g)

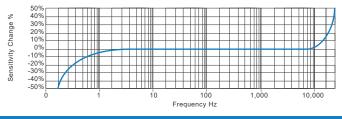


# **Applications**

Fans, Motors, Pumps, Compressors, Centrifuges, Conveyors, Air Handlers, Gearboxes, Rolls, Dryers, Presses, Cooling, VAC, Spindles, Machine Tooling, Process Equipment

Vibration sensor should be firmly fixed to a flat surface (spot face surface may be needed to be produced and cable anchored to sensor body.)



# How To Order

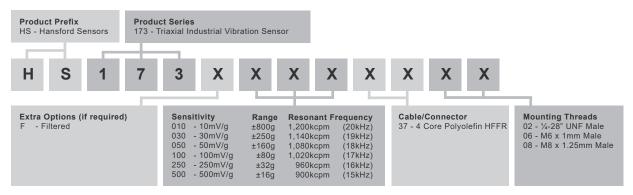



www.hansfordsensors.com sales@hansfordsensors.com

