# **HS-183 Premium Triaxial Accelerometer**

Three AC outputs via M12 Connector


# **Key Features**

- Output via three axes
- · Three way mounting option
- · Customisable features

#### Industries

Building services, Pulp and Paper, Mining, Metals, Utilities, Automotive, Water, Pharmaceutical



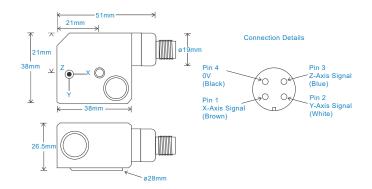

## **Technical Performance**

Mounted Base Resonance see 'How To Order' table (nominal) Sensitivity see: 'How To Order' table ±10% Nominal 80Hz at 22°C per axies Frequency Response 2Hz (120cpm) to 10kHz (600kcpm) ± 5% 1.5Hz (90cpm) to 12kHz (720kcpm) ± 10% 0.8Hz (48cpm) to 15kHz (900kcpm) ± 3dB Isolation Base isolated

see: 'How To Order' table Range Transverse Sensitivity Less than 5%

#### Mechanical

Case Material Stainless Steel Sensing Element/Construction PZT/Shear Mounting Torque Mounting Bolt Provided see: 'How To Order' table x 27mm long 235gms (nominal) - Stainless Steel HS-AC010 - straight Screened cable assembly Mounting Threads see: 'How To Order' table


#### Electrical

**Electrical Noise** 0.1mg max Current Range 0.5mA to 8mA Bias Voltage 10 - 12 Volts DC Settling Time 1 second Output Impedance 200 Ohms max Case Isolation >108 Ohms at 500 Volts

#### Environmental

-55 to 150°C Operating Temperature Range Sealing IP67 Maximum Shock 5000g EN61326-1:2013

# Typical Frequency Response (at 100mV/g)

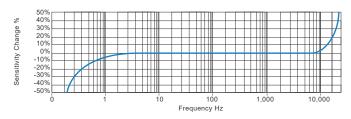


#### **Applications**

Fans, Motors, Pumps, Compressors, Centrifuges, Conveyors, Air Handlers, Gearboxes, Rolls, Dryers, Presses, Cooling, VAC, Spindles, Machine Tooling, Process Equipment

Vibration sensor should be firmly fixed to a flat surface (spot face surface may be needed to be produced and cable anchored to sensor body.)



## How To Order

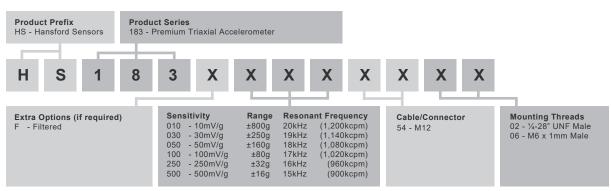



www.hansfordsensors.com sales@hansfordsensors.com

