HS-173 Premium Triaxial Accelerometer


AC acceleration output via PUR cable

Key Features

- · Output via three axes
- Waterproof
- · Resistant to oil

Industries

Building services, Pulp and Paper, Mining, Metals, Utilities, Automotive, Water, Pharmaceutical

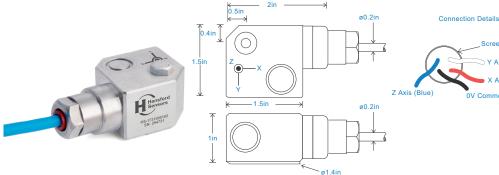

Technical Performance

 $\begin{array}{c} \mbox{Mounted Base Resonance} & \mbox{see 'How To Order' table (nominal)} \\ \mbox{Sensitivity} & \mbox{see: 'How To Order' table $\pm 10\%$} \\ \mbox{Nominal 80Hz at } 72^{\circ} \mbox{F per axies} \\ \mbox{Frequency Response} & 120 \mbox{cpm} (2Hz) \mbox{to } 600 \mbox{kcpm} (10 \mbox{kHz}) $\pm 5\%$} \\ \mbox{90 \mbox{cpm}} (1.5 \mbox{Hz}) \mbox{to } 720 \mbox{kcpm} (12 \mbox{kHz}) $\pm 10\%$} \\ \mbox{48 \mbox{cpm}} (0.8 \mbox{Hz}) \mbox{to } 900 \mbox{kcpm} (15 \mbox{kHz}) $\pm 3d \mbox{B}$} \\ \mbox{Isolation} & \mbox{Base isolated} \\ \mbox{Range} & \mbox{see: 'How To Order' table} \\ \mbox{Transverse Sensitivity} & \mbox{Less than } 5\% \\ \end{array}$

Mechanical

Case Material Stainless Steel unless specified Aluminium Sensing Element/Construction PZT/Shear 5.9ft. lbs Mounting Torque see: 'How To Order' table x 1.2in long Mounting Bolt Provided 8.3 oz. (nominal) - Stainless Steel Maximum Cable Length 3.280 ft. Standard Cable Length Screened Cable PUR - length to be specified with order Mounting Threads see: 'How To Order' table Mounting Stud HS-AS226, HS-AS221 or HS-AS222 Submersible Depth 328 ft. max (10 bar)

Electrical

 Electrical Noise
 0.1mg max

 Current Range
 0.5mA to 8mA

 Bias Voltage
 10 - 12 Volts DC

 Settling Time
 1 second


 Output Impedance
 200 Ohms max.

 Case Isolation
 >108 Ohms at 500 Volts

Environmental

Operating Temperature Range	-22 to 194°F
Sealing	IP68
Maximum Shock	5000g
EMC	EN61326-1:2013

Typical Frequency Response (at 100mV/g)




Applications

Fans, Motors, Pumps, Compressors, Centrifuges, Conveyors, Air Handlers, Gearboxes, Rolls, Dryers, Presses, Cooling, VAC, Spindles, Machine Tooling, Process Equipment

Vibration sensor should be firmly fixed to a flat surface (spot face surface may be needed to be produced and cable anchored to sensor body.)



How To Order

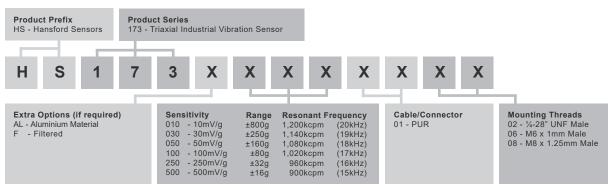



www.hansfordsensors.com sales@hansfordsensors.com

