# **HS-422 Accelerometer**

## 4-20mA acceleration output via M12 Connector

#### **Key Features**


- 4-20mA acceleration output
- · For use with PLC/DCS systems
- · Customizable features


#### Industries

Building services, Pulp and Paper, Mining, Metals, Utilities, Automotive, Water, Pharmaceutical



Less than 5%

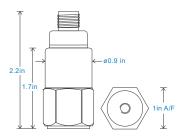

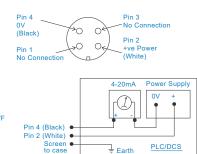

Connection Details

#### **Technical Performance**

 $\begin{array}{ccc} \mbox{Mounted Base Resonance} & 10\mbox{kHz min} \\ \mbox{Acceleration Ranges} & \mbox{see: 'How To Order' table $\pm 10\%$} \\ \mbox{Nominal 80Hz at 72°F} \\ \mbox{Frequency Response} & 600\mbox{cpm (10Hz) to 300\mbox{kcpm (5kHz)} $\pm 5\%$} \\ \mbox{- ISO10816} \\ \mbox{Isolation} & \mbox{Base isolated} \\ \mbox{Range} & \mbox{see: 'How To Order' table} \\ \end{array}$ 

#### Mechanical

Case Material Stainless Steel
Sensing Element/Construction PZT/Compression
Mounting Torque 5.9ft. Ibs
Weight 3.5 oz. (nominal) body only
Sheilded Cable Assembly HS-AC010 - straight
HS-AC011 - right angle
Mounting Threads see: 'How To Order' table

#### **Electrical**

Transverse Sensitivity

Current Output 4-20mA DC proportional to acceleration
Supply Voltage 15-30 Volts DC (for 4-20mA)
Settling Time 2 seconds
Output Impedance Loop Resistance 600 Ohms max. at 24 Volts
Case Isolation >108 Ohms at 500 Volts

#### Environmental


 Operating Temperature Range
 -13 to 248°F

 Sealing
 IP67

 Maximum Shock
 5000g

 EMC
 EN61326-1:2013

#### Typical Frequency Response

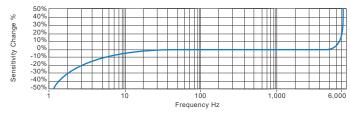


#### **Applications**

Fans, Motors, Pumps, Compressors, Centrifuges, Conveyors, Air Handlers, Gearboxes, Rolls, Dryers, Presses, Cooling, VAC, Spindles, Machine Tooling, Process Equipment

Vibration sensor should be firmly fixed to a flat surface (spot face surface may be needed to be produced and cable anchored to sensor body.)



### How To Order

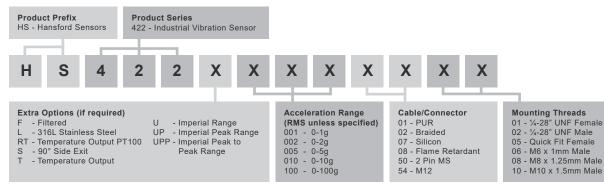



www.hansfordsensors.com sales@hansfordsensors.com

