# **HS-422SRT Accelerometer**

## 4-20mA acceleration and PT100 temperature output via PUR Cable


## **Key Features**

- · Side entry for easy access
- PT100 temperature output
- Waterproof
- · Resistant to oil

#### Industries

Building services, Pulp and Paper, Mining, Metals, Utilities, Automotive, Water, Pharmaceutical



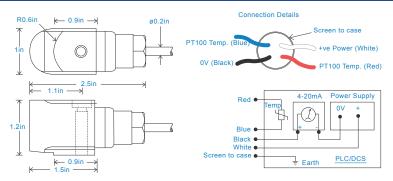

## Technical Performance

Mounted Base Resonance 10kHz min Acceleration Ranges see: 'How To Order' table ±10% Nominal 80Hz at 72°F Frequency Response 600cpm (10Hz) to 300kcpm (5kHz) ± 5% - ISO10816 Isolation Base isolated Range see: 'How To Order' table Temperature Output PT100 (100 Ohms) Transverse Sensitivity Less than 5%

## Mechanical

Case Material Stainless Steel Sensing Element/Construction PZT/Compression Mounting Torque 5.9ft. lbs Mounting Bolt Provided see: 'How To Order' table x 1.2in long Weight 6.5 oz. (nominal) Maximum Cable Length 3,280 ft. Standard Cable Length Sheilded Cable PUR - length to be specified with order Mounting Threads see: 'How To Order' table Submersible Depth 328 ft. max. (10 bar)


## Electrical

Current Output 4-20mA DC proportional to acceleration
Supply Voltage 15-30 Volts DC (for 4-20mA)
Settling Time 2 seconds
Output Impedance Loop Resistance 600 Ohms max. at 24 Volts
Case Isolation >108 Ohms at 500 Volts

## Environmental

Operating Temperature Range -13 to 194°F
Sealing IP68
Maximum Shock 5000g
EMC EN61326-1:2013

## Typical Frequency Response




## **Applications**

Fans, Motors, Pumps, Compressors, Centrifuges, Conveyors, Air Handlers, Gearboxes, Rolls, Dryers, Presses, Cooling, VAC, Spindles, Machine Tooling, Process Equipment

Vibration sensor should be firmly fixed to a flat surface (spot face surface may be needed to be produced and cable anchored to sensor body.)



## How To Order

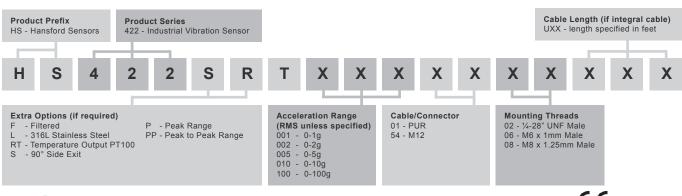



www.hansfordsensors.com sales@hansfordsensors.com

