

HS-420IT Intrinsically Safe Accelerometer

4-20mA velocity and temperature output via M12 Connector

Key Features


- Intrinsically Safe with European, USA, South African, and Indian approvals
- Approved SIL 2 and SIL 3
- For use with PLC/DCS systems
- Temperature output



Industries

Building services, Pulp and Paper, Metals, Utilities, Automotive, Water, Pharmaceutical

Connection Details

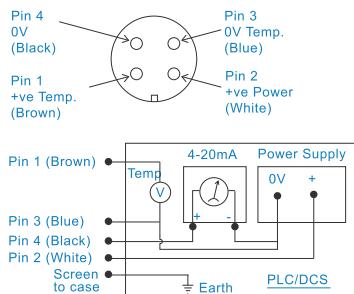

Technical Performance

Mounted Base Resonance	5kHz min
Velocity Ranges	see: 'How To Order' table ±10%
Frequency Response	Nominal 80Hz at 22°C
Isolation Range	10Hz (600cpm) to 1kHz (60kcpm) ± 5% - ISO10816
Temperature Output	Base isolated
Transverse Sensitivity	10mV/°C - 0-1V proportional to 0-100°C (to convert this to 4-20mA use the HS-540 module)
	Less than 5%

Mechanical

Case Material	Stainless Steel
Sensing Element/Construction	PZT/Compression
Mounting Torque	8Nm
Weight	150gms (nominal)
Screened Cable Assembly	HS-AC010 - straight
Mounting Threads	HS-AC011 - right angle
	see: 'How To Order' table


Electrical

Current Output	4-20mA DC proportional to Velocity Range
Supply Voltage	15-30 Volts DC (for 4-20mA)
Settling Time	2 seconds
Output Impedance	Loop Resistance 600 Ohms max. at 24 Volts
Case Isolation	>10 ⁸ Ohms at 500 Volts

Environmental

Operating Temperature Range	see: attached certification details
Sealing	IP67
Maximum Shock	5000g
EMC	EN61326-1:2013


Typical Frequency Response

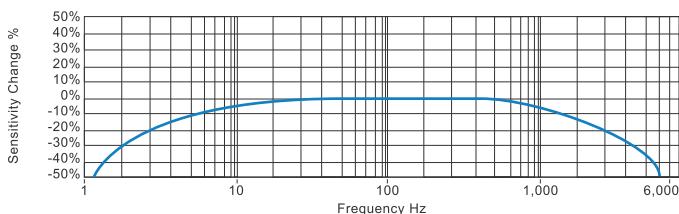

Applications

Fans, Motors, Pumps, Compressors, Centrifuges, Conveyors, Air Handlers, Gearboxes, Rolls, Dryers, Presses, Cooling, VAC, Spindles, Machine Tooling, Process Equipment

Vibration sensor should be firmly fixed to a flat surface (spot face surface may be needed to be produced and cable anchored to sensor body.)

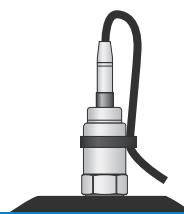

Certifications



This product is certified in accordance with
UL 913, 8th Ed. Rev. December 6, 2013
CAN/CSA C22.2 No. 157-92 (R2012) +Upd1 +Upd2



www.hansfordsensors.com
sales@hansfordsensors.com

We reserve the right to alter the specification of this product without prior notice

TS072.23




HS-420IT Intrinsically Safe Accelerometer


4-20mA velocity and temperature output via M12 Connector

Intrinsically Safe Requirements

Maximum Cable Length	See website: www.hansfordsensors.com see attached system drawings	US/Canada Approvals	Certificate No. SGSNA/18/SUW/0000231 Class I, II, III, Division 1, 2, Groups A - G, T4, -40°C to +110°C, Class I, Zone 0, AEx, ia, IIC, T4, Ga, -40°C to +110°C Zone 20, AEx, ia, IIIC, T130°C, IP65, Da, -40°C to +110°C
Certificate details: Group II	IECEx BAS08.0034X Baseefa08ATEX0086X Ex ia IIC T6 Ga Ex ia IIIC T80°C IP65 Da (-40°C ≤ Ta ≤ +60°C) Ex ia IIC T4 Ga Ex ia IIIC T130°C IP65 Da (-40°C ≤ Ta ≤ +110°C)	② II 1GD ② II 1GD	Barrier 1 x MTL Zener Barrier MTL7764+ac (BAS01ATEX7217) or Pepperl + Fuchs Zener Barrier Z764 (BAS01ATEX7005) or any other barrier that conforms to system drawings attached
Accelerometer System Certificate	Baseefa08Y0087 Ex ia IIC T6 (-40°C ≤ Ta ≤ +60°C) *On request - consult Sales Office	System Connections for Zener Barrier	see attached system drawings
Terminal Parameters	Ui = 44V, Ii = 117mA, Pi = 0.722W Group II	System Connections for Galvanic Isolator	see attached system drawings
500V Isolation	Units Will Pass A 500V Isolation Test	Terminal Parameters	Ui = Vmax = 28V Ii = Imax = 115mA Pi = 0.65W
Certified Temperature Range	Ex ia IIC T6 Ga (-40°C ≤ Ta ≤ +60°C) (Gas) Ex ia IIC T4 Ga (-40°C ≤ Ta ≤ +110°C) (Gas) Ex ia IIIC T80°C IP65 Da (-40°C ≤ Ta ≤ +60°C) (Dust) Ex ia IIIC T130°C IP65 Da (-40°C ≤ Ta ≤ +110°C) (Dust)	Notes:	Special conditions of safe use for Group II dust. The free end of the cable on the integral cable version of the apparatus must be terminated in an appropriately certified dust-proof enclosure. The unit has no serviceable parts.
South African Approval	Certificate No. MASC MS/16-0229X Group I and II (As Baseefa/ATEX)		

How To Order

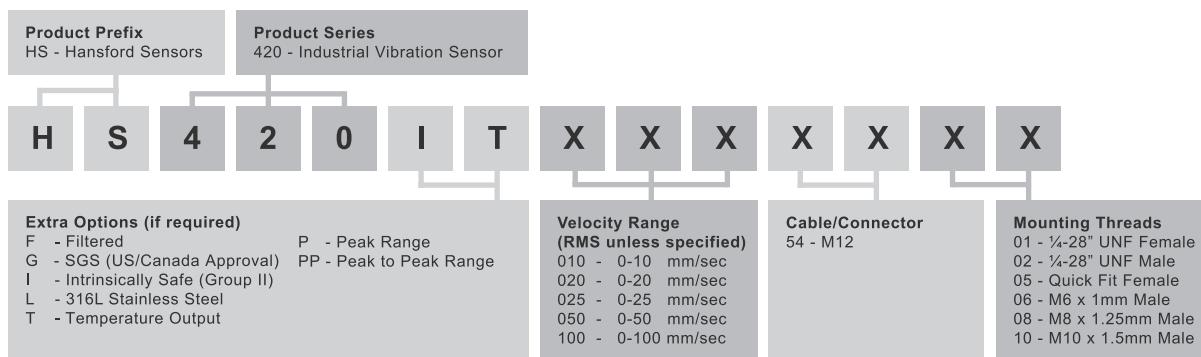

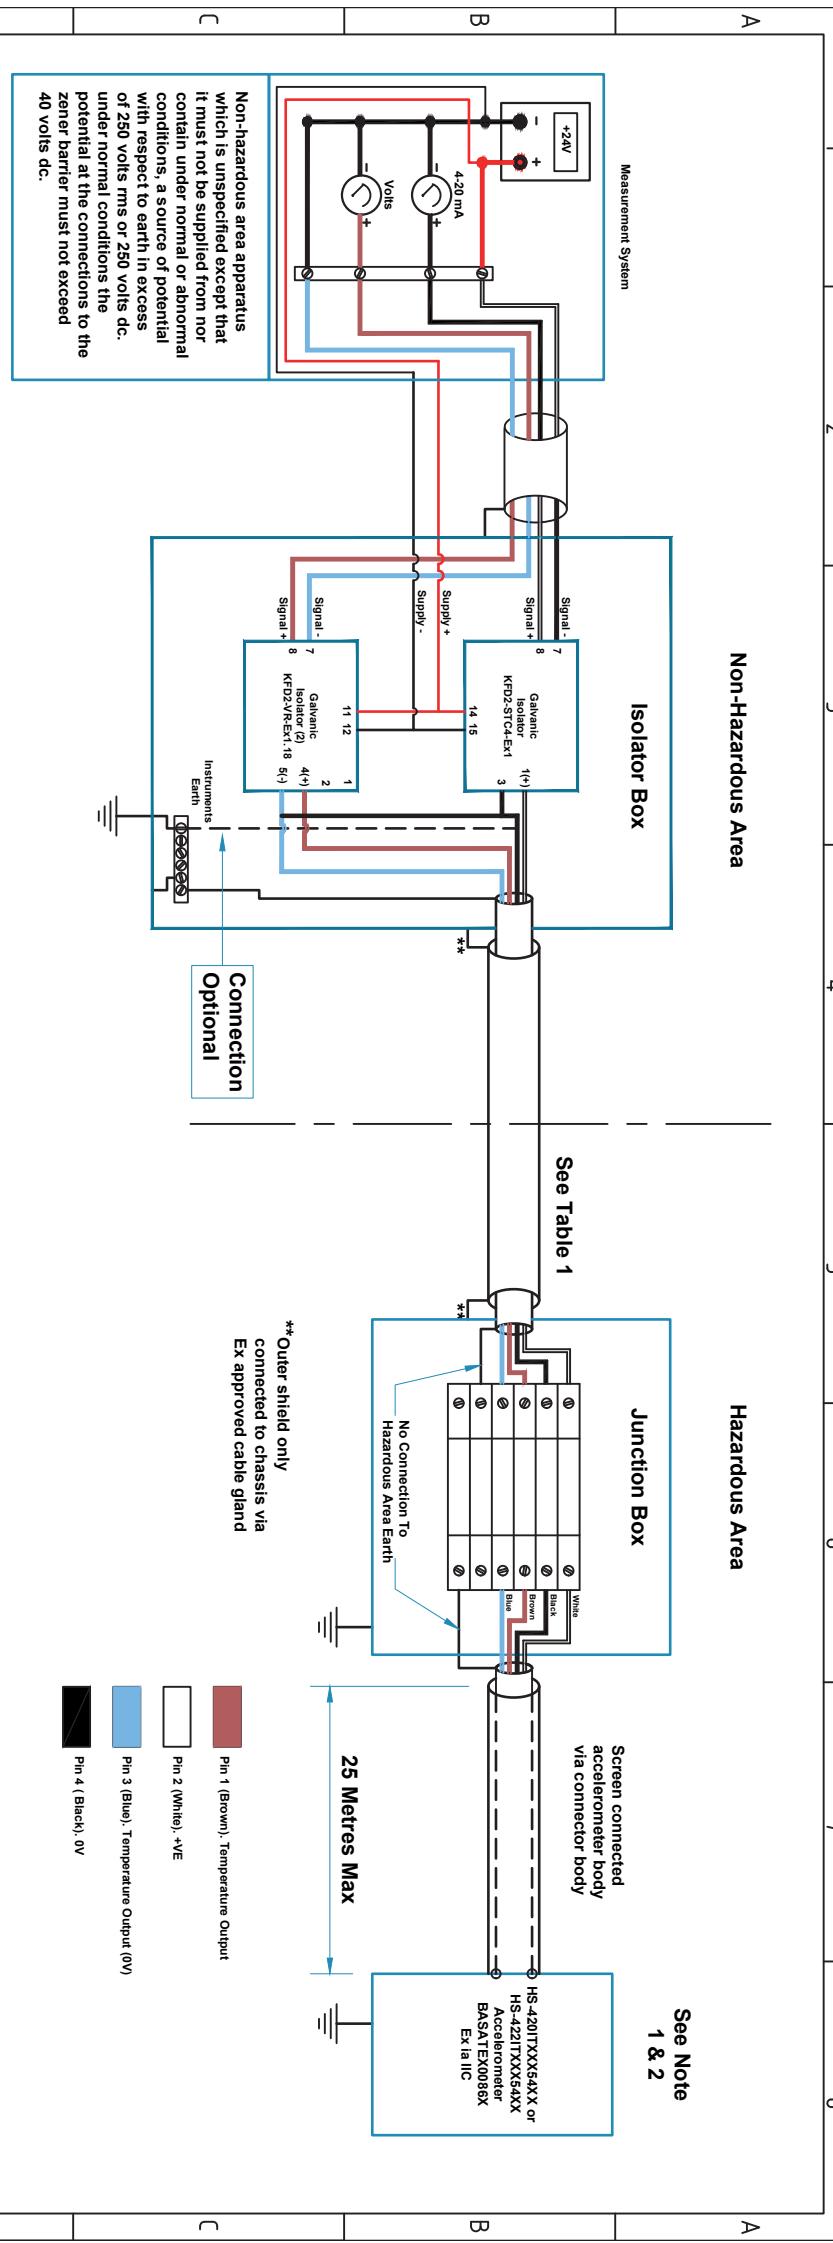

Non-Hazardous Area


Hazardous Area

See Note
1 & 2

Barrier Box

Junction Box

Measurement System

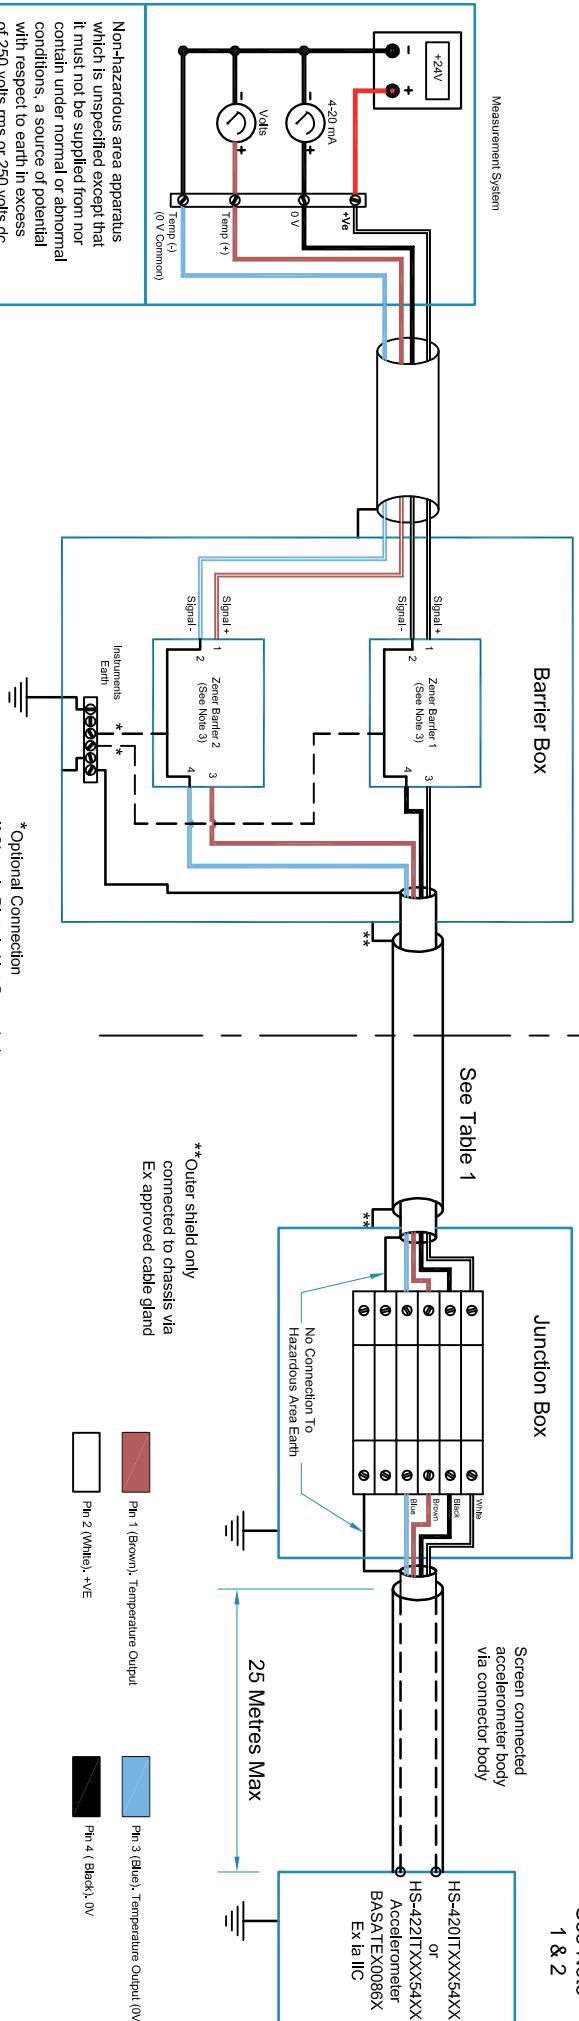Screen connected
accelerometer body
via connector bodyHS-4201TXXX54XX
or
HS-421TXXX54XX
Accelerometer
BASA/TEX0086X
Ex ia IIC

Non-hazardous area apparatus
which is unspecified except that
it must not be supplied from nor
contain under normal or abnormal
conditions, a source of potential
with respect to earth, in excess
of 250 volts rms or 250 volts dc.
Under normal conditions the
potential at the connections to the
zener barrier must not exceed
400 volts dc.

Table 1: Cable Connecting The Connector Version

Rev No	DRF No	Date Drg	Drg By	Appd By	Material: N/A
A	Release	16/04/15	MJS	CMH	
					Tolerances Unless Stated
					0 or 0.0 ±0.5 1/16 Finish All Over
					0.00 ±0.15 Angle
					Threads 96 H6
					Hansford Sensors Ltd Artisan, Hillbottom Rd Sands Industrial Estate High Wycombe Bucks HP12 4HJ

Hansford Sensors Ltd

HS-4201T & HS-4221T
Accelerometer System

Ex ia IIC T6 (-40°C ≤ Ta ≤ +60°C)

Notes:

1. The capacitance and inductance, or inductance - to - resistance ratio (L/R) of hazardous area cable, must not exceed the values shown in Table 1.
2. The cable from the accelerometer to the junction box must not be installed in a high velocity dust laden atmosphere
3. Zener diode safety barrier (1) certified by an ec approved body to [Ex ia] IIC having the following output parameters: $U_0 = 28V$ dc, $I_0 = 93mA$ dc, $P_{0.65W}$, e.g. MTL7787+ to BAS01ATEX7217 or Pepperl + Fuchs Z787 to BAS01ATEX7005
- Zener diode safety barrier (2) certified by an ec approved body to [Ex ia] IIC having the following output parameters: $U_0 = 12V$ dc, $I_0 = 12mA$ dc, $P_0 = 0.036W$, MTL7764+ac to BAS01ATEX7217 or Pepperl + Fuchs Z764 to BAS01ATEX7005.
4. The installer is to perform a risk assessment in accordance with clause 10 of EN 60079-25 and install lightning protection arrestors as deemed necessary.

D	E	F
1	2	3
		4
		5
		6
		7
		8