HS-420I/M Intrinsically Safe Accelerometer

4-20mA velocity output via 2 Pin MS Connector


Key Features

- Intrinsically Safe with European, USA, Australian, South African, and Indian approvals
- Approved SIL 2 and SIL 3
- For use with PLC/DCS systems
- · Customisable features

Industries

Building services, Pulp and Paper, Mining, Metals, Utilities, Automotive, Water, Pharmaceutical



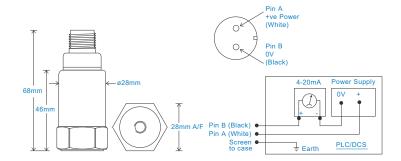

Connection Details

Technical Performance

Mounted Base Resonance 5kHz min

Velocity Ranges see: 'How To Order' table ±10%

Nominal 80Hz at 22°C

Frequency Response 10Hz (600cpm) to 1kHz (60kcpm) ± 5% - ISO10816

Isolation Base isolated

Range 50g peak

Transverse Sensitivity Less than 5%

Mechanical

Case Material Stainless Steel
Sensing Element/Construction PZT/Compression
Mounting Torque 8Nm
Weight 150gms (nominal)
Screened Cable Asssembly see: www.hansfordsensors.com for options
Connector HS-AA054 - non-booted
HS-AA053 or HS-AA054 - booted
Mounting Threads see: 'How To Order' table


Electrical

Current Output 4-20mA DC proportional to Velocity Range
Supply Voltage 15-30 Volts DC (for 4-20mA)
Settling Time 2 seconds
Output Impedance Loop Resistance 600 Ohms max. at 24 Volts
Case Isolation >10⁸ Ohms at 500 Volts

Environmental

Operating Temperature Range see: attached certification details
Sealing IP68
Maximum Shock 5000g
EMC EN61326-1:2013

Typical Frequency Response



Applications

Fans, Motors, Pumps, Compressors, Centrifuges, Conveyors, Air Handlers, Gearboxes, Rolls, Dryers, Presses, Cooling, VAC, Spindles, Machine Tooling, Process Equipment

Vibration sensor should be firmly fixed to a flat surface (spot face surface may be needed to be produced and cable anchored to sensor body.)



Certifications













This product is certified in accordance with UL 913, 8th Ed. Rev. December 6, 2013 CAN/CSA C22.2 No. 157-92 (R2012) +Upd1 +Upd2



www.hansfordsensors.com sales@hansfordsensors.com



HS-420I/M Intrinsically Safe Accelerometer

4-20mA velocity output via 2 Pin MS Connector

Intrinsically Safe Requirements

Maximum Cable Length See website: www.hansfordsensors.com see attached system drawings

Certificate details: Group I + II IECEx BAS08.0034X Baseefa08ATEX0086X

®II 1GD

Ex ia IIC T6 Ga

Ex ia IIIC T80°C IP65 Da

□ M1

Ex ia I Ma

 $(-40^{\circ}\text{C} \le \text{Ta} \le +60^{\circ}\text{C})$

⊞II 1GD Certificate details: Group II Ex ia IIC T4 Ga

> Ex ia IIIC T130°C IP65 Da $(-40^{\circ}\text{C} \le \text{Ta} \le +110^{\circ}\text{C})$

Accelerometer System Certificate Baseefa08Y0087

Ex ia IIC T6 (-40°C \leq Ta \leq +60°C) *On request - consult Sales Office

Terminal Parameters Ui = 28V, Ii = 115mA, Pi = 0.65W Group II

Ui = 16.5V Pi = 0.65W

or Ui = 28V Ii = 115mA Pi = 0.65W Group I

500V Isolation Units Will Pass A 500V Isolation Test

Certified Temperature Range Ex ia IIC T6 Ga (-40°C ≤ Ta ≤ +60°C) (Gas) Ex ia IIC T4 Ga (- 40° C \leq Ta \leq + 110° C) (Gas)

Ex ia IIIC T80°C IP65 Da (-40°C \le Ta \le +60°C) (Dust)

Ex ia IIIC T130°C IP65 Da (-40°C \leq Ta \leq +110°C) (Dust) Ex ia I Ma (-40°C \leq Ta \leq +60°C) (Mining)

Australia Approval Group 1

IECEx ITA 10.0003X

Ex ia I Ma $(-40^{\circ}\text{C} \le \text{Ta} \le +60^{\circ}\text{C})$

Certificate No. MASC MS/16-0229X South African Approval

Group I and II (As Baseefa/ATEX)

US/Canada Approvals Certificate No. SGSNA/18/SUW/0000231 Class I, II, III, Division 1, 2, Groups A - G, T4, -40°C to +110°C, Class I, Zone 0, AEx, ia, IIC, T4, Ga, -40°C to +110°C Zone 20, AEx, ia, IIIC, T130°C, IP65, Da, -40°C to +110°C

1 x Pepperl + Fuchs Galvanic Isolator KFD2-STC4-Ex1, which has superseded

KFD2-CR-Ex1.30300 (BAS00ATEX7164) see attached system drawings

1 x MTL Zener Barrier MTL7787+ (BAS01ATEX7217) or Pepperl + Fuchs Zener Barrier

Z787 (BAS01ATEX7005) or any other barrier that

conforms to system drawings attached

System Connections for Zener Barrier see attached system drawings

System Connections for Galvanic Isolator see attached system drawings

Terminal Parameters Ui = Vmax = 28V li = lmax = 115mA

Pi = 0.65W

Notes: Special conditions of safe use for Group II dust.

The free end of the cable on the integral cable version of the apparatus must be terminated in an appropriately certified dust-proof enclosure. The unit has no serviceable parts.

How To Order

