# **HS-422S Accelerometer**

# 4-20mA acceleration output via M12 Connector


## **Key Features**


- 4-20mA acceleration output
- · For use with PLC/DCS systems
- · Side entry for easy access

#### Industries

Building services, Pulp and Paper, Mining, Metals, Utilities, Automotive, Water, Pharmaceutical



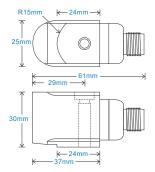

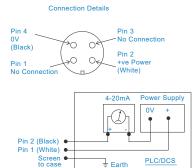

## **Technical Performance**

 $\begin{array}{c} \mbox{Mounted Base Resonance} & 10\mbox{kHz min} \\ \mbox{Acceleration Ranges} & \mbox{see: 'How To Order' table $\pm 10\%$} \\ \mbox{Nominal 80Hz at } 22\mbox{°C} \\ \mbox{Frequency Response} & 10\mbox{Hz} (600\mbox{cpm}) \mbox{ to } 5\mbox{kHz} (300\mbox{kcpm}) $\pm 5\%$} \\ \mbox{- ISO10816} \\ \mbox{Isolation} & \mbox{Base isolated} \\ \mbox{Range} & \mbox{see: 'How To Order' table} \\ \mbox{Transverse Sensitivity} & \mbox{Less than } 5\% \\ \end{array}$ 

#### Mechanical

Case Material Stainless Steel
Sensing Element/Construction PZT/Shear
Mounting Torque 8Nm
Mounting Bolt Provided see: 'How To Order' table x 30mm long
Weight 185gms (nominal) body only
Screened Cable Assembly HS-AC010 - straight
HS-AC011 - right angle
Mounting Threads see: 'How To Order' table

#### Electrical

Current Output

4-20mA DC proportional to acceleration

Supply Voltage

15-30 Volts DC (for 4-20mA)

Settling Time

1 second

Output Impedance

Loop Resistance 600 Ohms max. at 24 Volts

Case Isolation

>108 Ohms at 500 Volts

#### Environmental


 Operating Temperature Range
 -25 to 120°C

 Sealing
 IP67

 Maximum Shock
 5000g

 EMC
 EN61326-1:2013

## Typical Frequency Response

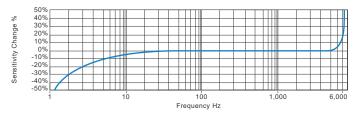


#### **Applications**

Fans, Motors, Pumps, Compressors, Centrifuges, Conveyors, Air Handlers, Gearboxes, Rolls, Dryers, Presses, Cooling, VAC, Spindles, Machine Tooling, Process Equipment

Vibration sensor should be firmly fixed to a flat surface (spot face surface may be needed to be produced and cable anchored to sensor body.)



## How To Order

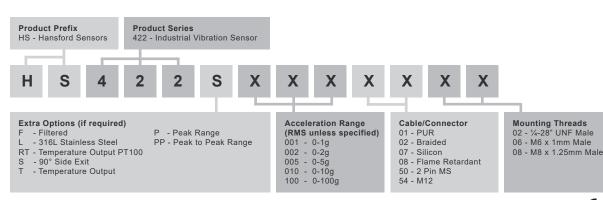



www.hansfordsensors.com sales@hansfordsensors.com



