HS-422 Accelerometer

4-20mA acceleration output via 2 Pin MS Connector


Key Features


- 4-20mA acceleration output
- · For use with PLC/DCS systems
- · Customisable features

Industries

Building services, Pulp and Paper, Mining, Metals, Utilities, Automotive, Water, Pharmaceutical



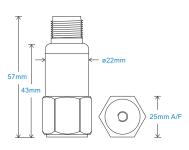

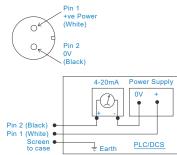

Connection Details

Technical Performance

 $\begin{array}{c} \mbox{Mounted Base Resonance} & 10\mbox{kHz min} \\ \mbox{Acceleration Ranges} & \mbox{see: 'How To Order' table $\pm 10\%$} \\ \mbox{Nominal 80Hz at 22°C} \\ \mbox{Frequency Response} & 10\mbox{Hz (600cpm) to 5kHz (300kcpm)} $\pm 5\%$} \\ \mbox{- ISO10816} \\ \mbox{Isolation} & \mbox{Base isolated} \\ \mbox{Range} & \mbox{see: 'How To Order' table} \\ \mbox{Transverse Sensitivity} & \mbox{Less than } 5\% \\ \end{array}$

Mechanical

Case Material Stainless Steel
Sensing Element/Construction PZT/Compression
Mounting Torque 8Nm
Weight 100gms (nominal) body only
Screened Cable Assembly see: www.hansfordsensors.com for options
Connector HS-AA004 - non-booted
HS-AA053 or HS-0054 - booted
Mounting Threads see: 'How To Order' table

Electrical

Current Output 4-20mA DC proportional to acceleration
Supply Voltage 15-30 Volts DC (for 4-20mA)
Settling Time 2 seconds
Output Impedance Loop Resistance 600 Ohms max. at 24 Volts
Case Isolation >108 Ohms at 500 Volts

Environmental


 Operating Temperature Range
 -25 to 120°C

 Sealing
 IP68

 Maximum Shock
 5000g

 EMC
 EN61326-1:2013

Typical Frequency Response




Applications

Fans, Motors, Pumps, Compressors, Centrifuges, Conveyors, Air Handlers, Gearboxes, Rolls, Dryers, Presses, Cooling, VAC, Spindles, Machine Tooling, Process Equipment

Vibration sensor should be firmly fixed to a flat surface (spot face surface may be needed to be produced and cable anchored to sensor body.)



How To Order

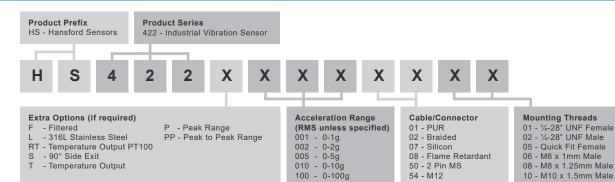



www.hansfordsensors.com sales@hansfordsensors.com



